

# Manhole Inspection Summary

Manhole # S33KK\_005MH

Printed On: 12/17/2008

Page 1 of 4

**Inspection** ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **33KK** Node: **005** Status: **Found**

Insp Date: **12/6/06 12:44 PM**

Incomplete Comments

Crew: **JS, DE**  
Inspector: **Smutek, J**  
Firm: **REI**

**Location** Address: **1801 LAFAYETTE AVE**

Cross Street: **FALLS RD**

**Manhole** Type: **Junction** Location: **Alley**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

**Cover** Shape: **Circular** Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame** Offset: **3** (in.)

Condition: ☐ Sound

☐ Cracked

☒ **Leaks**

**Chimney / Frame Adjustment** ☐ Exists Material:

☐ Parged Height: (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Corbel** Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

**Barrel** Material: **Brick**

☐ Parged

Shape: **D-Shape**

Diameter: **46** (in.) Length: **56** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Bench** ☒ Exists Material: **Brick**

☐ Parged ☒ **Debris** (not Condition related)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Channel** Material: **Brick**

☐ Parged

☐ Debris (not Condition related)

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

**Steps** Count: **5** Missing: **0** ☐ Corroded

**Surcharge** ☒ **Evidence Of Surcharge** Depth: **1.5** (ft.) ☐ Active Surcharge Present

# Manhole Inspection Summary

Manhole # S33KK\_005MH

Printed On: 12/17/2008

Page 2 of 4

Location View



Top View



Evidence of surcharge - Bench debris.  
Channel debris.

Defect



Frame leaks. Frame offset. Corbel  
deterioration and infiltration.

## Manhole Inspection Summary

Manhole # S33KK\_005MH

Printed On: 12/17/2008

Page 3 of 4

### 8 in. Circular Gravity Sewer Pipe Out @ 12 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **10.52** (ft.) Flow Characteristics: **Slow**

Deposits: ☐ None ☒ **Mud** ☐ Sludge ☒ **Debris** ☒ **Grease**

Silt Depth: **4** (in.) Deposits Extent: **Medium**


Infiltration: **Evidence** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

### 8 in. Circular Gravity Sewer Pipe In @ 3 O'Clock

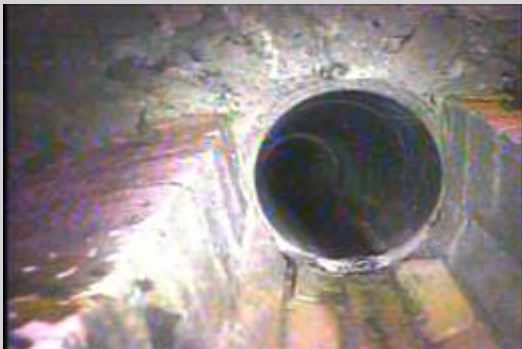

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **7.74** (ft.) Flow Characteristics: **None**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ **Debris** ☐ **Grease**

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence** Pipe Seal Cond: **Cracked**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

# Manhole Inspection Summary

Manhole # S33KK\_005MH

Printed On: 12/17/2008

Page 4 of 4

8 in. Circular Gravity Sewer

Pipe In @ 7 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay**

☐ Pipe Lined

Invert Depth: **8.10** (ft.) Flow Characteristics: **None**

Deposits: ☐ None ☐ Mud ☐ Sludge ☒ **Debris** ☒ **Grease**

Silt Depth: **0** (in.)

Deposits Extent: **Light**

Infiltration: **Evidence**

Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection